

## Pro CG and 5"+ Long Pin Drilling Instructions


Track Flare Bowtie is measured from the MB through the pin..!!

PAP Balance Hole

Place pin above the fingers, with the MB on, or just below the midline. Balance hole will be in the thumb quadrant.

For balls with low starting top, place balance hole, on a line from the Center of Grip, extending out 10" to add top weight, moving the ending CG to your desired location.


Track Flare Bowtie is measured from the MB through the pin..!!

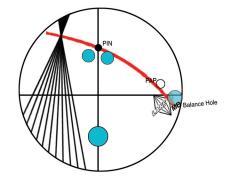

Long Pins will have a similar layout as the Pro CG, but the balance hole will go near the midline and/or past 6 3/4" to add top weight.

## **Hints**


Place balance hole wherever necessary to end with the desired ending static weights and/or desired ending center of gravity location. Track Flare Bowtie is measured from the MB through the pin..!!

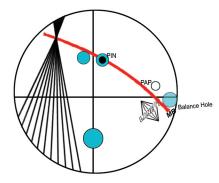

Higher tracks, place the pin inside the ring finger area, for more hook. Keep the MB no more than 1" below the midline.

Balls with higher top weight, place hole no more than 6 3/4" from the center of your grip.


CG Left (normally for righties)

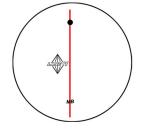

Balls with CG Left or CG right will use different balance hole locations to get to the desired ending static weights.

Balance holes less than 29/32" can be place in the center of flare rings with no thumping.

CG Right (normally for lefties)

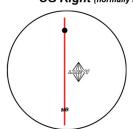

For Answers To Any Questions On Drilling, Please Call...

Lane #1 Tech Support 1-800-526-3661 or text 315-412-1776

Updated 11/12/15